

Work Order ID 143855

Thursday, March 24, 2016 10:13:53 AM

143855

Page 1

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MUFDate: 16-3-24

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

DAS

8

9-89

D412-664-243

F

MCS 16-05-02

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 010

DAS
27
9-89

16/5/4

110

Packaging

0.00

110

Packaging

Memo

0.05

Packaging

BC

18/04/05

120

BENDING MACHINE - CROSSTUBES

0.00

120

CNC Bend 2

Memo

0.02

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010

BC

16/04/05

D412-664-203 / 143855

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Thursday, March 24, 2016 10:13:53 AM

1 43855

Page 2

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Aft Crosstube - High

Stop *NS2*

Start Date: 3/28/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 4/8/2016 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Run Start *NR1*

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop ***NR2***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

QC15- Crosstube Dimensional Check

0.00

130

OC

Quality Control

Memo

0.00

140

0.00

140

Crosstubes

Crosstubes

Crosstubes

Memo

0.02

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-SCRIBE PART # & BATCH #
ACCORDING TO NOTE 6

4. *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243

1 of 1 6/04/03
DAS
49
9-89

550 &
wers.
fig
n cuffs,

BC 16/04/06

* Debur
D412-

BC 16/04/07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 143855***143855***

Page 3

Thursday, March 24, 2016 10:13:53 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

160

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

IMMEDIATELY AFTER GRINDING

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT AS PER QSI005.

BL 16/04/07

165

QC7-Inspect Chemical Conversion Coat

0.00

165

QC

Memo

0.00

Quality Control

DAS
38
9-89

APR 07 2016

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Memo

0.00

Quality Control

INSPECT ENGRAVING AND BATCH # 143855

1 16/04/07

DAS
49
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER :			

Work Order ID 143855

Thursday, March 24, 2016 10:13:53 AM

143855

Page 4

Item ID: D412-664-203 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Aft Crosstube - High
Start Date: 3/28/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/8/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 *180* Outsource2 Outsource process - NDT	Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038Or Issue P/O: <u>31971</u> LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	0.00 3.00				<u>1</u>		APR 1 1 2016	DAS 13 9-89
190 *190* Packaging Packaging	Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for transit damage Ensure copy of NDT results attached to work order.	0.00 0.00						<u>1x SP/6 ex-12</u>	
200 *200* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D412-664-203	0.00 0.00				<u>1</u>			DAS 38 9-89 APR 2 8 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐ _____					

1 43855

Thursday, March 24, 2016 10:13:53 AM

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 3/28/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 4/8/2016 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Run Start *NR1*

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop ***NR2***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Tool ID	Tool #	Plan Code
---------	--------	-----------

Accept Qty	Reject Qty	Reject Number	Insp. Stamp

0.00

210

SprayPaint

0.01

SprayPaint

Spray Painting

Memo

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

**VERIFY BY DAS BATCH # TO MATCH W/O

***VERIFY BY 41 PART # TO MATCH

W/O 9-89

MASK SCRIBE B# & P# AND VERIFY

Mask underside of crosstube as shown

1-Prime inside and outside crosstube as per QSI 005 4.2 AND DWG

PRIMER: 134454

START TIME: 1 00

FINISH TIME: 200

2-Paint outside crosstube with White Imron as per DWG D412-664-243 and QSI 005 4.2

PAINT: 134341

Start Time: 7⁰⁰

Finish Time: 8:00

3- Apply clear coat after paint as per DWG

133641

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 143855

143855

Page 6

Thursday, March 24, 2016 10:13:53 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220	QC14- Inspect Spray Paint	0.00							38
220						1			9-88
QC	Memo	0.00							MAY 04 2016
Quality Control	Then, Wrap in plastic bag to protect from scratches								



Work Order update only

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. _____		Rework ☐		Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐		
NCR No. _____		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process								
Misidentified ☐	☐ Past Due	OTHER :							

Work Order ID 143855

Thursday, March 24, 2016 10:13:53 AM

143855

Page 7

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							DAS
230	Crosstubes					1			41
Crosstubes									9-89
Crosstubes	Memo	0.02							16-4-25
	Assemble as per Dwg D412-664-203								
	1- Install center support using scoth-weld DP460 per QSI 015, as per DWG. note 13. Install supports clamps using as per Dwg D412-644-243. Install clamp with rubber cushion as per DWG. note 14. ***ENSURE CLAMPS ARE ON TOP OF CROSTUBE SUPPORT*** Torque clamps on support to 80-100 IN-LBS AS PER DWG.								
	A/R scoth-weld DP460	BATCH #: 132504							
		EXP DATE: 8/16							
	2- **IF NOT ALREADY PRESENT ON CHAFFING SHEILD.** Apply a thin coat of proseal 890 per QSI 015 on inside concave surface of chafing shield and let cure per manufacturer's instructions. Install prosealed chafing shield onto crosstube by applying a thin coat of proseal 890 onto crosstube. Be sure to eliminate any air gaps. Install and torque clamps on chafing shield to 40-50 IN-LBS AS PER DWG.								
	A/R Proseal 890	Batch: 134500							
		EXP DATE: 9/16							
	AFTER FINISH CURE TIME 24H								
	START CURE TIME: 16-4-25								
	FINISH CURE TIME: 16-4-26								
	PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.								

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		☐ OTHER : _____							

Work Order ID 143855

Thursday, March 24, 2016 10:13:53 AM

143855

Page 8

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	QC5- Inspect part completeness to step on W/O	0.00							38 9-89
240									
QC	Memo	0.00							
Quality Control	***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 24HOURS AS PER DWG.***								MAY 04 2016
250	Pick Kit	0.00							
250									
Packaging	Memo	0.00							
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00							
260									
QC	Memo	0.00							
Quality Control									

DAS 28
6 9-89
APR 30 2016

DAS 27
9-89

16/5/4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
QC / QA Coordinator Approval									

Root Cause			FAULT CATEGORY							
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date ☐	☐	Manufacturing Process	OTHER : _____							
Misidentified ☐	☐	Past Due								

Work Order ID 143855***143855***

Page 9

Thursday, March 24, 2016 10:13:53 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/28/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/8/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

270

0.00

270

Packaging

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D412-664-203

*****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27

for application time & date *****

Time & date of packaging: **MAY 04 2016**Location: **fs 094****DAS
27
9-89****MAY 04 2016**

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

ML5**MAY 05 2016****ML5****MAY 04 2016**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, March 24, 2016 10:13:52 AM

Page 1

Work Order ID: 143855

143855

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Aft Crosstube - High

Start Date: 3/28/2016

Required Date: 4/8/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16Reformat; Added D3189-1K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 06.12.08 per ECN 886 EC
 IPP Rev:H 07-04-30 As per Rev D JLM
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	DAS Date Issued 9-89	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	-------------------------------	--------

AN6-40A		Purchased	No			250	Each	50.0000	4	4			
AN6-40A									**				DAS 28 9-89
3/8-24 BOLT X 3" LONG													

DAS
27
9-89

Location	Loc Qty	Loc Code
over005	24	
M133316	24	
ST333	26	
M133769	26	

AN6-41A		Purchased	No			250	Each	27.0000	2	2			
AN6-41A									**				DAS 6 9-89
Bolt													

APR 30 2016

DAS
28
9-89

DAS
27
9-89

Location	Loc Qty	Loc Code
ST286A	1	
M129913	1	
ST333	26	
M131957	1	
M133577	25	

D2896-1		Manufactured	No			230	Each	5.0000	1	1			
D2896-1									**				DAS 41 9-89
Support													16-4-25

Location	Loc Qty	Loc Code
LG051	5	
134290	5	

1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
								QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____	
Misidentified ☐	Past Due ☐																																																														

Picklist Print

Page 2

Thursday, March 24, 2016 10:13:52 AM

Work Order ID: 143855

143855

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Aft Crosstube - High

Start Date: 3/28/2016

Required Date: 4/8/2016

Start Qty: 1.00

Required Qty: 1.00

D3189-1 Manufactured No

230 Each 0.0000 2 2

DAS

D3189-1

143836

**

2

41

9-89

16-4-25

Chaffing Shield

D3595-063-570 Manufactured No

230 Each 17.0000 2 2

DAS

D3595-063-570

**

41

9-89

16-4-25

Rubber Cushion 0.63" wide x 5.70" Long

Location

Loc Qty

Loc Code

FG

12

42243

12

LG052

5

140622

5

2

D412-664-203TRN Manufactured No

110 Each 4.0000 1 1

**

1

BL 16/04/05

D412-664-203TRN

Crosstube Turning Detail

Location

Loc Qty

Loc Code

LG014

4

142061

1

142062

1

142063

1

142064

1

MS21042L6 Purchased No

250 Each 198.0000 6 6

**

6

DAS

6

9-89

APR 30 2016

MS21042L6

Nut

Location

Loc Qty

Loc Code

OVER007

100

m134055

100

ST303

98

m133938

10

m134257

38

m134502

50

DAS

27

9-89

Thursday, March 24, 2016 10:13:52 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, March 24, 2016 10:13:52 AM

Work Order ID: 143855

143855

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Aft Crosstube - High

Start Date: 3/28/2016

Required Date: 4/8/2016

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased

No

230

Each

20.0000

4

4

DAS

41

9-89

16-4-25

MS21920-28

Clamp

Location

Loc Qty

Loc Code

FG

1

105884

1

LG051

1

M132169

1

LG057

18

M134130

18

MS21920-30

Purchased

No

230

Each

40.0000

2

2

DAS

41

9-89

16-4-25

MS21920-30

Clamp

Location

Loc Qty

Loc Code

LG57

40

m131689

20

m134257

20

NAS1149D0663J

Purchased

No

250

Each

900.0000

18

18

NAS1149D0663.J

Washer

Location

Loc Qty

Loc Code

ST260

227

M131618

227

ST260a

500

M134360

500

ST263

122

M133134

89

M133769

12

M133812

21

ST269

51

M126334

51

DAS
27
9-89

DAS
8
9-89

DAS
28
9-89

APR 30 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890 B-2	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: DART P/N "D412-664-243" AND B/N ON INSIDE OF CUFF PER QSI 044 6.4 (VIBRATING STYLUS)
- WEIGHT: 47.0 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. DO NOT GRIND TUBE AFTER SHOT PEEN.

TURNING

- WHEN TRANSITIONING TO STOCK MAT'L, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R30 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

143853

RELEASED
2014-05-26

F	NOTES RE-ORDERED, SCOTCH-WELD WAS MAGNOBOND (C8-1), ADD CLAMP RETORQUE (A8-1), REMOVE ABRASION STRIP, ADD INSPECTION WINDOW (C8-1), CHAFING SHIELD NOW 4.38 WIDE (C6-2), ADD 7% CRUSHING (B8-1), CHG BEND HEIGHT TOL. TO ±0.25 (C1-3), CHG CLIFF TOL. (D2-4), CLAMPS FLIPPED TO PREVENT CHAFING (B7-2, B7-3), INCORP. DEO E-2/-4	CP	14.04.01
E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #8 PER PAR 08-048 (ZN A8-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	qp	DART AEROSPACE LTD	
DRAWN	qp	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. F
MFG. APPR.	SA	D412-664-243	SHEET 1 OF 4
APPROVED	SA	TITLE	SCALE
DE APPR.	SA	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____






WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

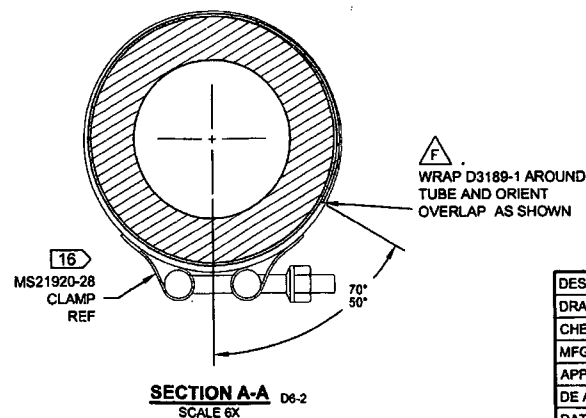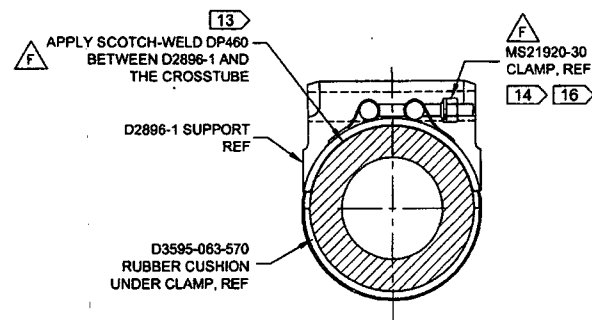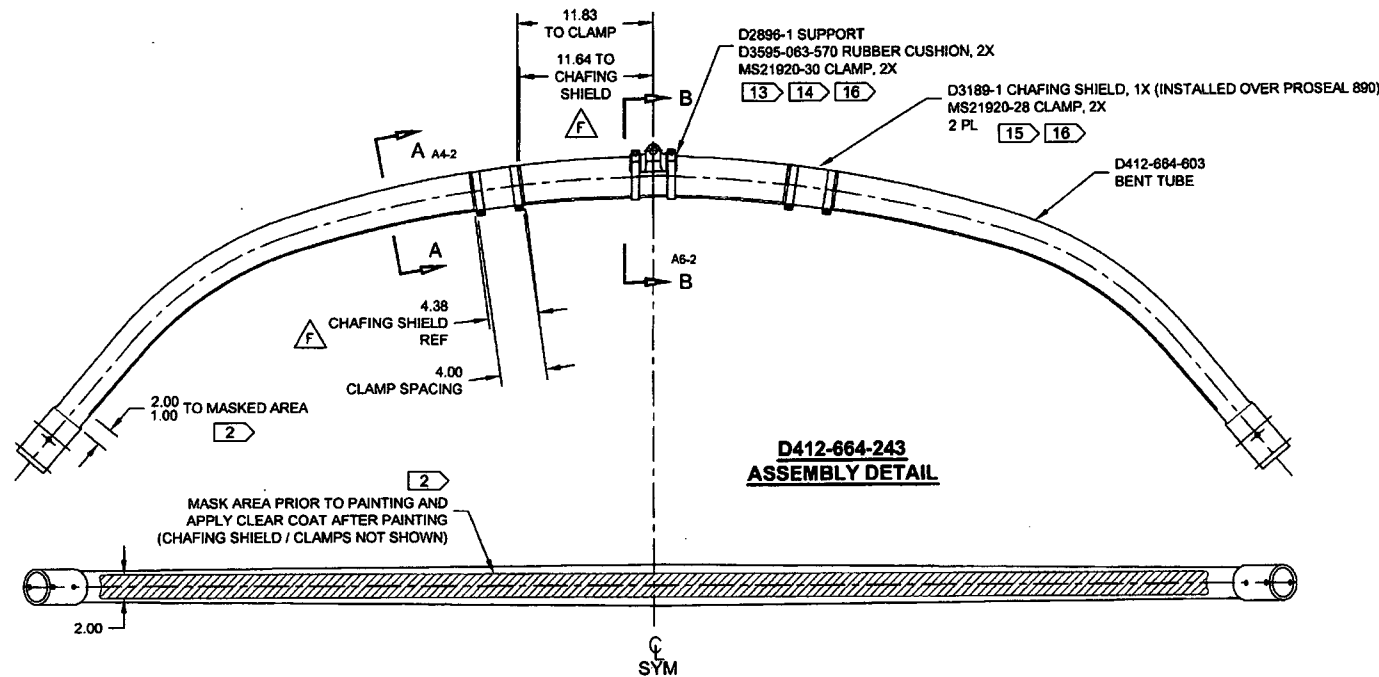

RELEASED
2014-05-26

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DLW	DRAWING NO.	REV. F
MFG. APPR.		D412-664-243	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					


8 7 6 5 4 3 2 1

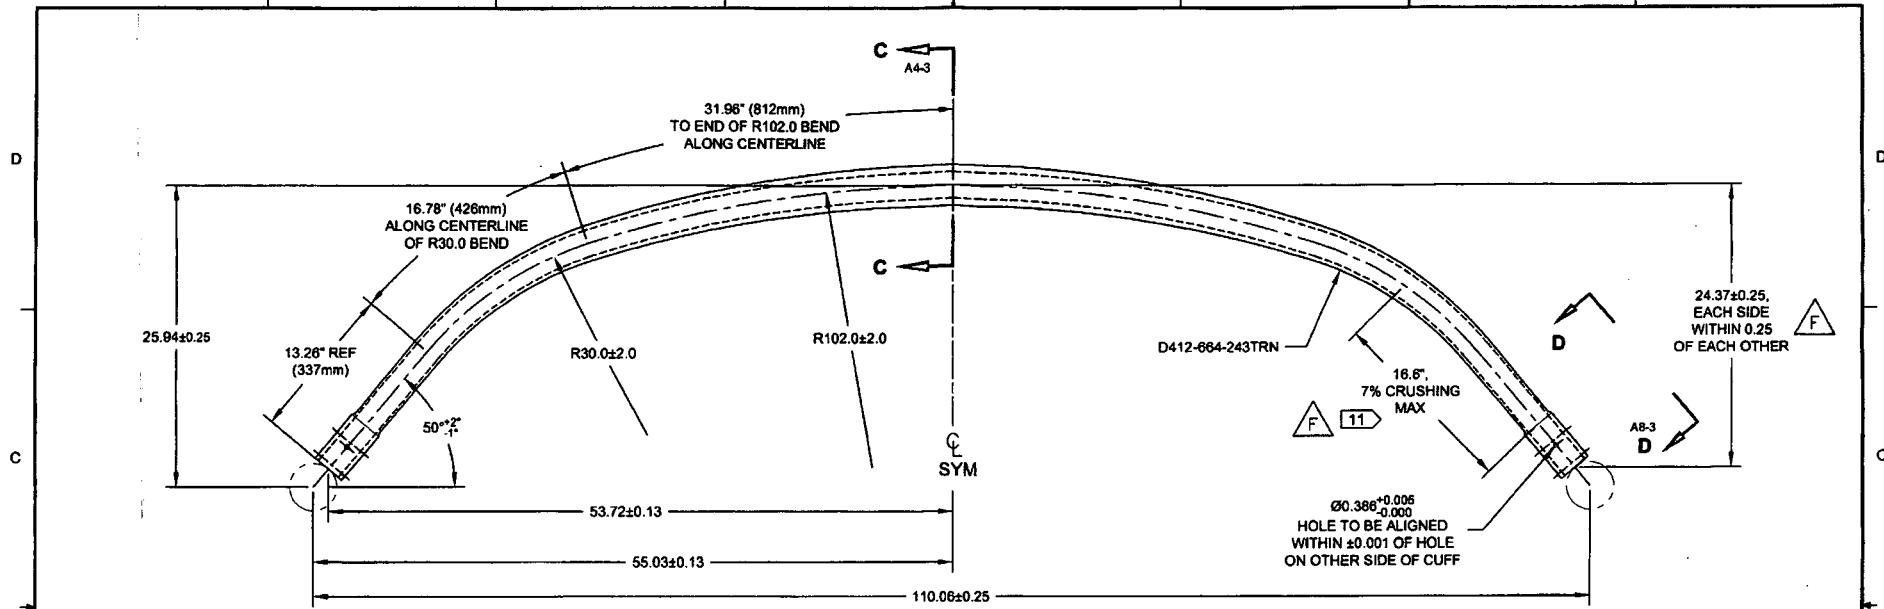

D412-664-603
BENDING AND DRILLING DETAIL

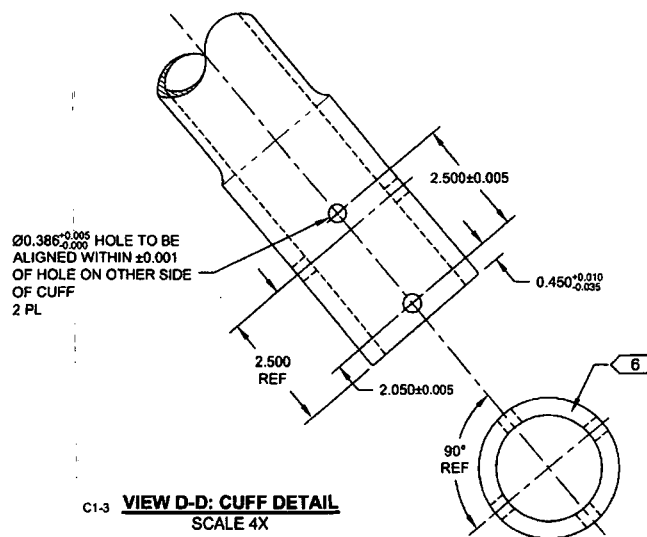

C1-3 **VIEW D-D: CUFF DETAIL**
SCALE 4X

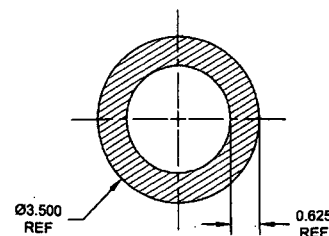

SECTION C-C D5-3
SCALE 4X

RELEASED
2014-05-26

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. F
MFG. APPR.	15	D412-664-243	SHEET 3 OF 4
APPROVED	15	TITLE	SCALE
DE APPR.	15	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPILED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					


Root Cause			FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	Past Due ☐							

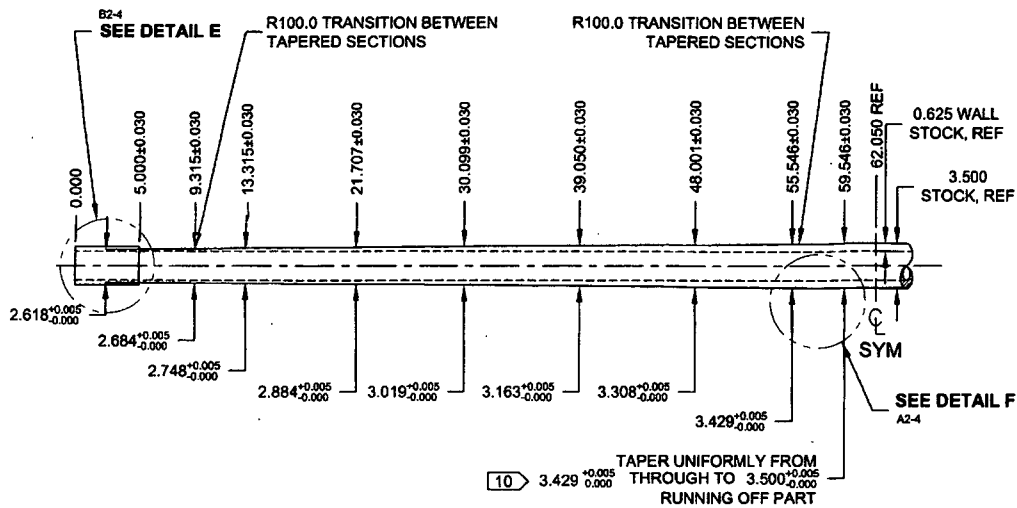


D412-664-243TRN
TURNING DETAIL

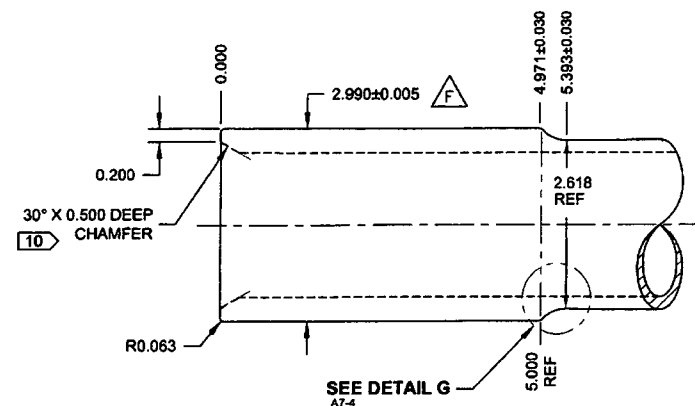

DETAIL E:
CROSSTUBE CUFF
SCALE 5X

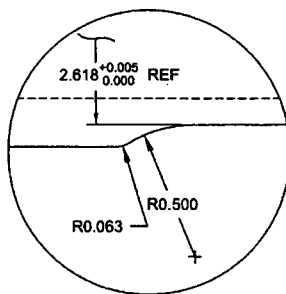

DETAIL G:
CUFF TRANSITION
SCALE 10X

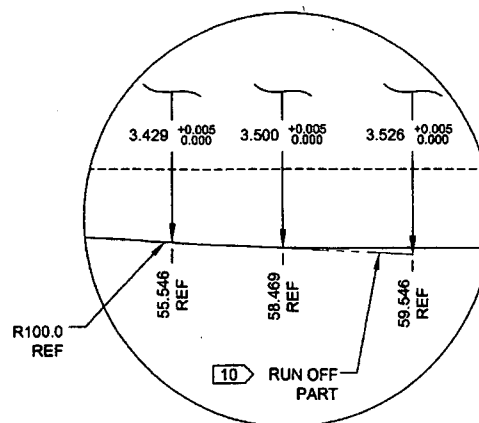

DETAIL F:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	<i>g</i>	DART AEROSPACE LTD	
DRAWN	<i>g</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>W</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>W</i>	D412-664-243	SHEET 4 OF 4
APPROVED	<i>W</i>	TITLE	SCALE
DE APPR.	<i>W</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date ☐	☐	Manufacturing Process	☐				
Misidentified ☐	☐	Past Due	☐				

DART AEROSPACE LTD	Work Order:	143885
Description: Crosstube High Aft (412)	Part Number:	D412-664-203
Inspection Dwg: D412-664-243 Rev: F		Page 1 of 1

Required Dimension	Min	Max
Height	24.12	24.62
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	8	--
Crushing	--	7%

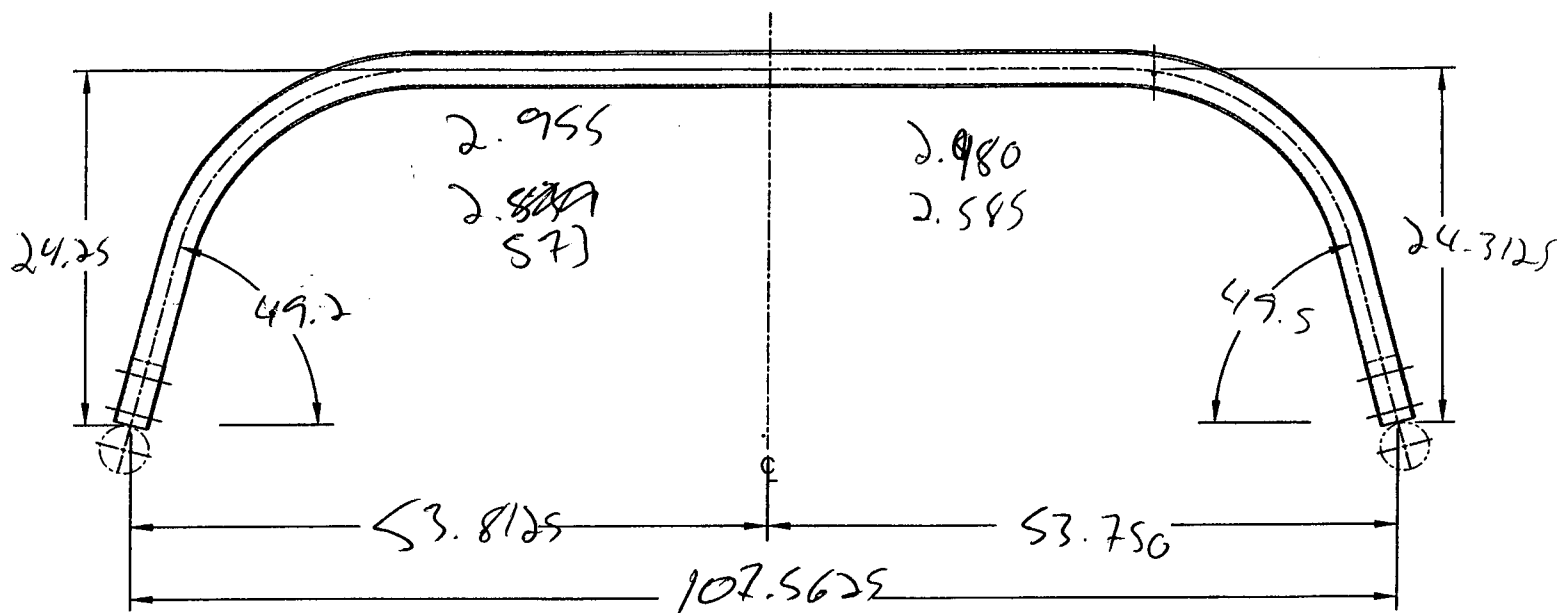

	Side A	Side B
Bending Passes	10	9
Crushing	6.9%	7.0%
Comments		

QC15 Inspection	DAS
Date	49
	9-89

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.09.08	Max crushing % revised	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO31971**

Purchase Order Date 4/7/2016

PO Print Date 4/11/2016

Page Number 2 of 4

Order From :
SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

VC-SKY001

Ship To : DART AEROSPACE LTD
1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name
Vendor Phone 905-678-5636

Ship To Contact
Ship To Phone
Ship Via: Delivered
Ship Acct:

Buyer Chantal Lavoie
Customer POID
Customer Tax # 10127-2607
Terms Net 30
Currency CAD
FOB FCA - (Free Carrier)

Line Total: \$135.00

3 143855 D412-664-203 ✓ 4/11/2016

1.00

\$135.00 \$135.00

Yes
4/11/2016

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

SP 16-04-12

Line Total: \$135.00

4 143856 D412-664-203 4/11/2016

1.00

\$135.00 \$135.00

Yes
4/11/2016

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$135.00

5 142085 D412-664-403 4/11/2016

1.00

\$135.00 \$135.00

Yes
4/11/2016

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Note:

4/11/2016

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO27855	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO31971
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT (LIQUID PENETRANT CRACK TEST) ON THE FOLLOWING seven (7) CROSSTUBES:


ID# D412-664-403 STAINLESS STEEL AFT CROSSTUBES-HIGH

1 WORK ORDER ID 142085 2-WORK ORDER ID 142086
3.WORK ORDER ID 142087 4-WORK ORDER ID 143893

ID# D412-664-203 AFT CROSSTUBES-HIGH

5 WORK ORDER ID 143853 6 WORK ORDER ID 143855
7 WORK ORDER ID 143856

2/6-04-12

Action Taken:						Date:	Initial/Stamp:
LIQUID PENETRANT INSPECTION CARRIED OUT ON ITEMS LISTED ABOVE (ITEMS 1-7) AS PER ASTM1417 M-13						<i>11 APR 20/6</i>	
NO APPARENT DEFECT FOUND							
PEN.(ZL-56, MPO13600), DEV.(SKD-S2, MPO11715), CLEANER(SKC-S, MPO13923)							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

DAS
38
9-88

APR 28 2016

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature: 	ACA/SCA Stamp 	Date: <i>11 APR 20/6</i>
Name: <i>CHRISTIAN BRIEN</i>		